
Table of Contents

Basic Measuring Techniques

Subject	Page
Basic Engine Measurements	3
Vernier Measurement	4
Micrometer Measurements	6
Metric Micrometer Construction	6
Dial Indicator Measurements	9
Examples of Dial Indicator Measurements	10
Additional Engine Measurements	12
Cylinder Head Measurement	12
Piston Measurements	14
Piston Ring Measurements	15
Cylinder Bore	16
Reading Technique	16
How to Use a Dial Bore Gauge	17
Setup	17
Using the Dial Indicator	18
Tips & Warnings	18
Plastigage	19
Units of Measure	21
Metric System	21
Metric System Denominations	21
Metric Reference Chart	22
Metric System Conversion Charts	23
Pressure Conversion Chart	24

Basic Measuring Techniques

Model: All

OBJECTIVES

After completion of this module you will be able to:

- Use basic measuring tools
- Perform basic engine measurements
- Understand metric measurements

Basic Engine Measurements

During the course of engine repairs some basic engine measurements are required to verify engine diagnosis as well as to complete proper repairs. These measurements are made by precision measuring tools such as micrometers, Vernier calipers, cylinder bore gauges and dial indicators.



N52 engine cut-away

Also, a working knowledge of the metric system is also a vital skill that is needed by the technician. All BMW engine measurements consist of metric specifications. Some of the routine engine measurements performed include:

- Valve Guide Wear (Tilt Angle K)
- Cylinder Bore Measurements (Taper and Out-of-Round)
- Cylinder Head Warpage and Thickness
- Axial and Radial Endplay Measurements (Crankshaft/Camshaft etc)


Among all of the skills possessed by a modern technician, basic measuring techniques are perhaps the most overlooked and least used. This is why it is important to review these skills from time to time as a refresher.

Also, it is necessary to access technical data to obtain the proper specifications for these measurements. This course is designed to review measuring techniques to assist in engine diagnosis.

Vernier Measurement

The Vernier scale is used on various measuring tools such as the Vernier caliper and the Depth Gauge. The Vernier scale can be used with Fractional (US) and Metric systems. For the purposes of this training module we will always refer to the Metric Vernier scale.

The Vernier scale consists of a fixed scale and a sliding scale. The fixed scale is divided with graduations in 1 millimeter increments. The sliding scale has 10 graduations in increments of 0.5.

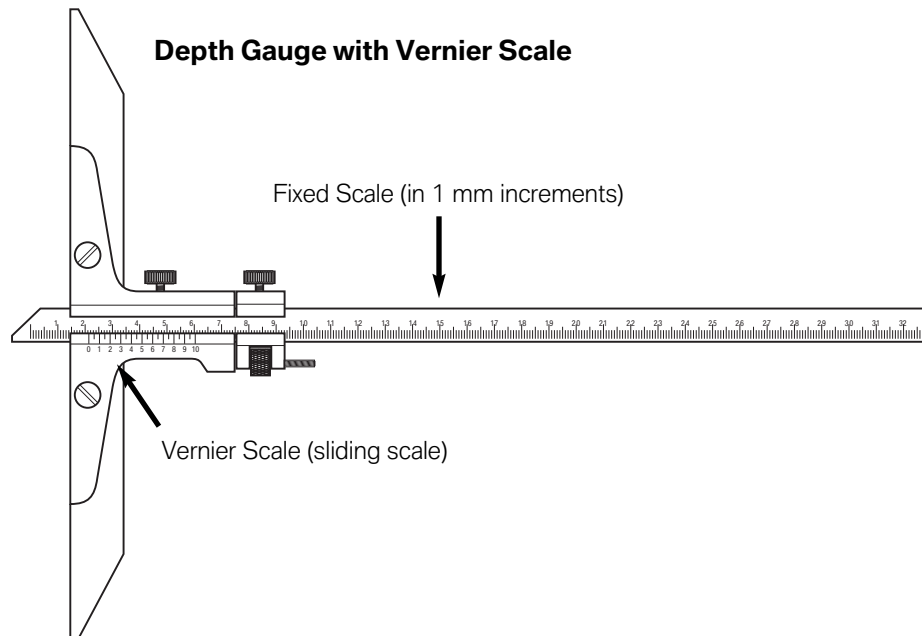


In order to read a measurement, use the zero mark on the left end of the vernier scale to use as a guide to read a measurement on the fixed scale.

In the example shown at the right, the zero mark is resting between 26 and 27 mm. Therefore the base measurement is 26 mm.

Next, the decimal measurement must be taken. For this, find a line on the Vernier that most closely matches any line on the fixed scale.

Using the example drawing, the "4" on the Vernier scale is lining up directly with a line on the fixed scale.

Combining the previous reading with this reading, the result would be 26.4 mm.

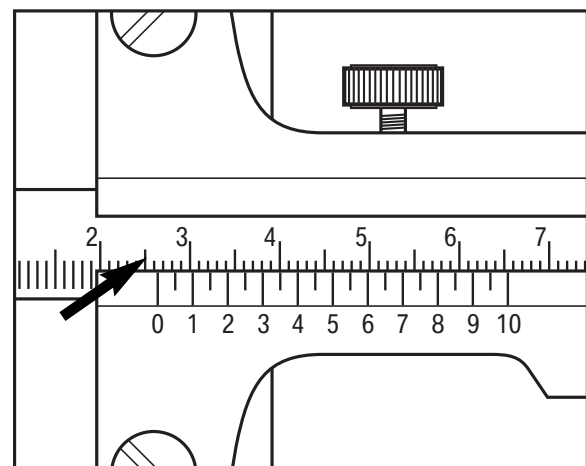


The designations on the Vernier scale are in increments of 0.5. For example, if a reading on the Vernier scale falls on the 0.5 (i.e. 2.5, 3.5 etc) designation this would indicate 5/100th's of a millimeter.



Classroom Exercise - Vernier Readings


Fill in the correct Vernier scale readings in the spaces provided below.

Vernier 1

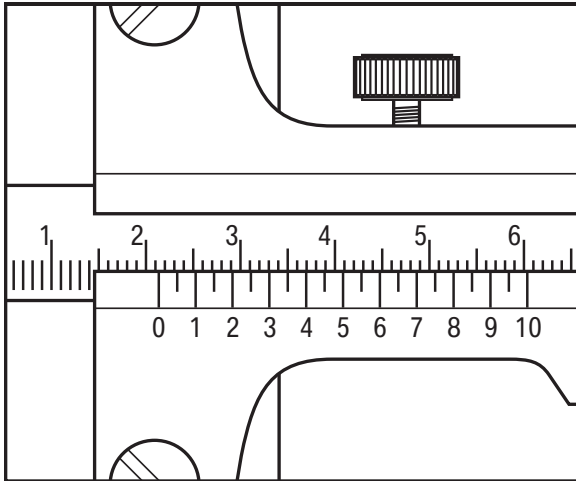


Vernier Reading 1:

Vernier 2

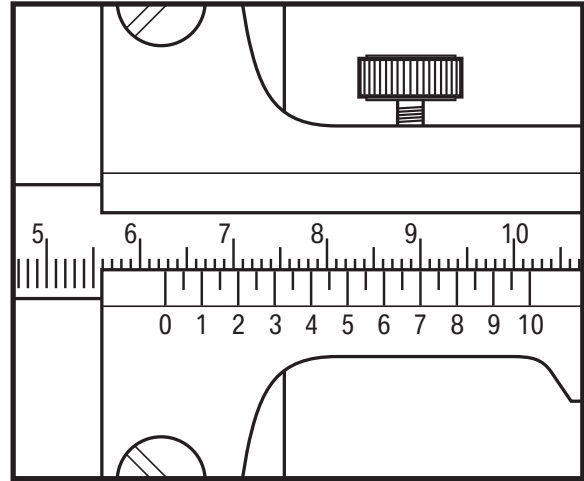


Vernier Reading 2:

Vernier 3

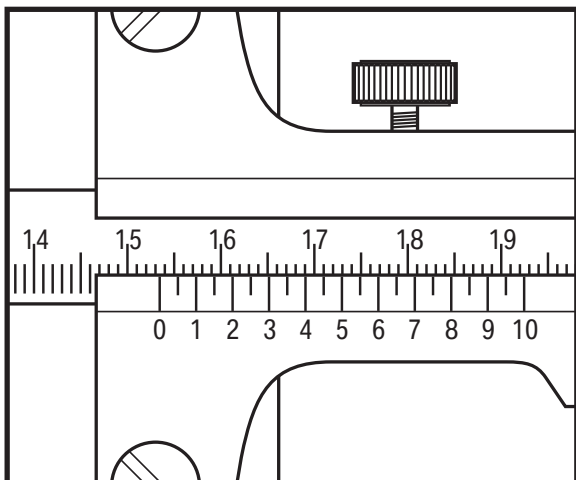

Vernier Reading 3:

Vernier 4

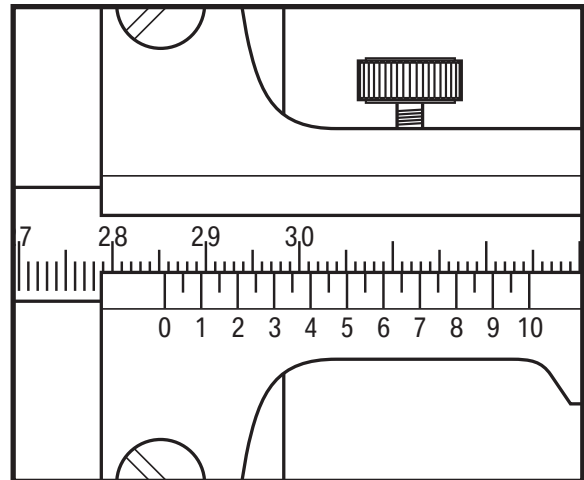

Vernier Reading 4:

Micrometer Measurements


Another valuable measuring tool is the micrometer, which can be used for measurements such as bearing journal diameter, cylinder head thickness, valve shim thickness and brake rotor thickness etc. Micrometers also come in configurations for inside measurements as well.

The micrometer scale comes in both fractional and metric varieties. We will cover only the metric micrometer scale in this course.

First you must familiarize yourself with the construction of the micrometer in order to understand how measurements are made.

Metric Micrometer Construction

The micrometer is constructed of a few basic parts. The actual item to be measured is placed between the anvil and the spindle. The micrometer can be adjusted to the approximate size using the thimble. The thimble should only be used for the coarse adjustment. In order to make the actual measurement, the micrometer should only be turned using the ratchet (a.k.a. the friction stop). Do not attempt to make a measurement using the thimble. This will give an inaccurate measurement and ultimately damage the micrometer.

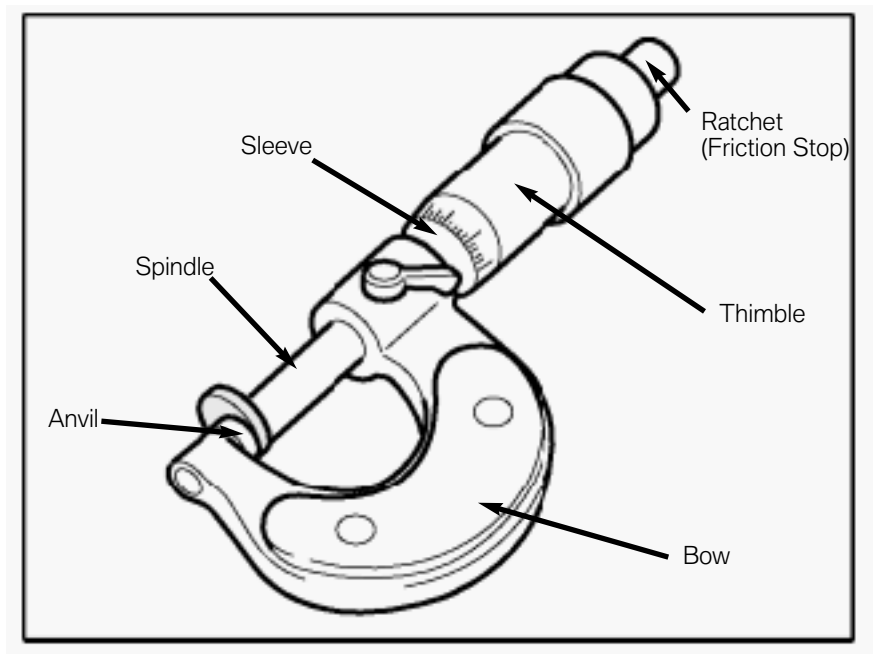


Micrometers are available in various sizes for outside as well as inside measurements. The more common variation is the outside micrometer. They are usually available in 25 millimeter increments such as 0-25 mm, 25-50 mm, 50-75 mm etc..

The metric micrometer can measure in increments of one hundredth of a millimeter (0.01mm). One hundredth of a millimeter is equal to 0.0003937 inch which is less than one thousandth of an inch.

The measurement area of the micrometer consists of the sleeve scale and the thimble scale. The sleeve scale is used to read whole and half millimeters. The thimble scale (which rotates) reads in hundredths (0.01) of a millimeter from zero to fifty. Two complete revolutions of the thimble equals one millimeter.

On the sleeve scale, each scale mark above the center line indicates whole millimeters. Below the center line, half of a millimeter (or 0.5mm) increments are indicated.

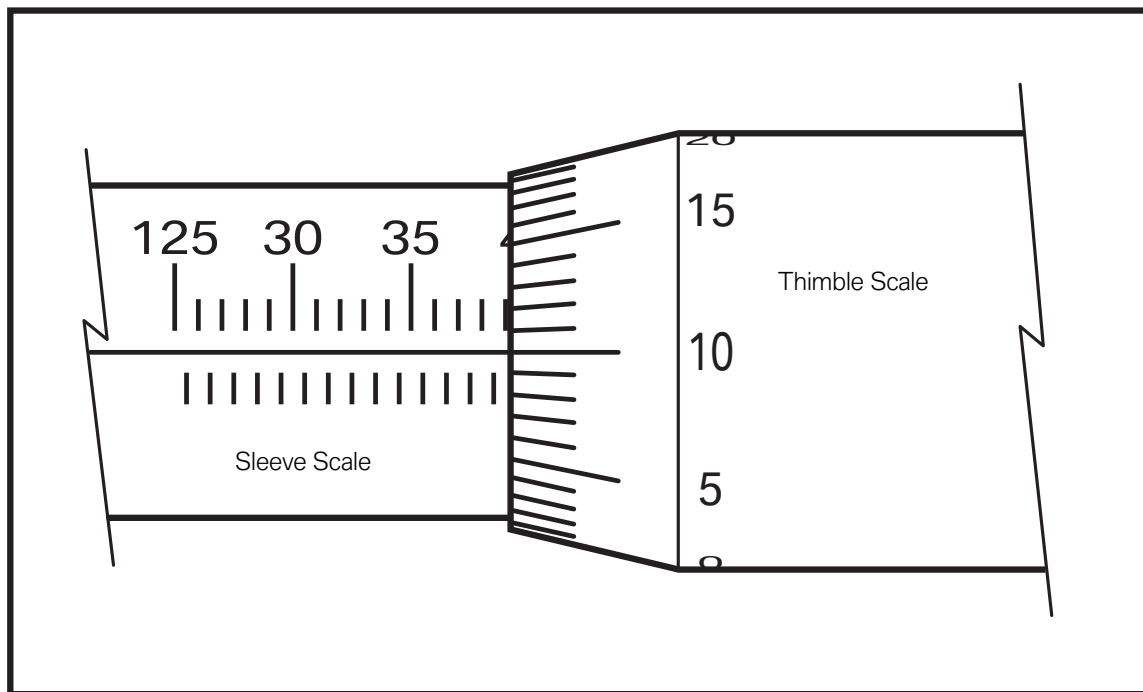


Using the example shown above, the micrometer is a 125-150mm micrometer. To read this micrometer, first take the basic reading from the sleeve scale. The thimble is past the 139 mm mark. Therefore the reading is at least 139 mm. Next, look at the thimble scale and note the reading on the centerline. The "10" on the thimble scale is lined up with the centerline. This indicates a reading of 0.10 mm. If you add the two readings; $139 + .10 = 139.10$ mm.




Classroom Exercise - Micrometer Measurements


Fill in the correct micrometer readings in the spaces provided below.

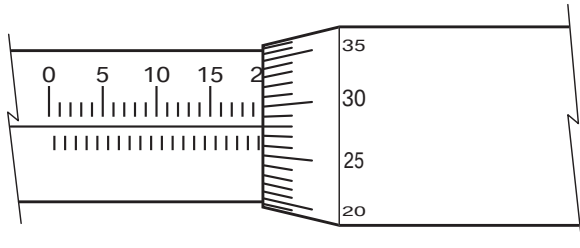


Micrometer Reading 1:

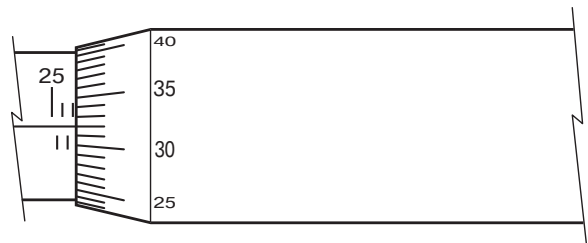

Micrometer Reading 2:

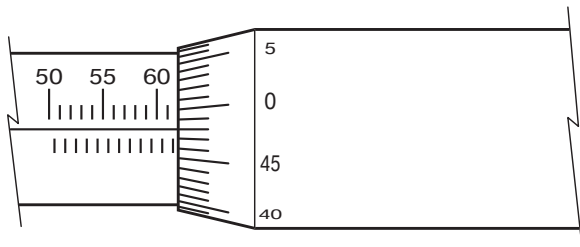

Micrometer Reading 3:

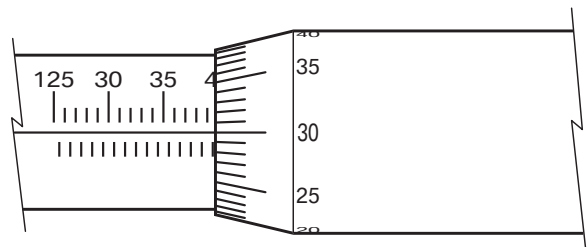

Micrometer Reading 4:

Dial Indicator Measurements

The dial indicator is used to measure the travel or movement of a specific item. It can also be used to measure axial and radial runout. In engine measurement applications, the dial indicator can be used to measure valve guide wear, axial movement of the crankshaft (thrust), and runout of flywheels and harmonic balancers.

First, it is important to familiarize yourself with Dial Indicator construction. The face of the dial indicator consists of a moveable bezel which is also attached to the large measuring scale. This allows the tool be brought to the “zero point” when needed.

The main measuring device is the contact point. The contact point (1) is placed against the object to be measured. Usually, the contact point is rounded or has a ball bearing. This allows for a more accurate measurement.



The measuring face of the dial indicator consists of 2 scales. The smaller scale is for the ‘coarse’ measurement which is in graduations of 1 millimeter. One revolution of the small scale is 10 millimeters.

The large scale is in graduations of 0.01 millimeter and the scale goes from zero to one hundred. Therefore, one revolution of the large scale is one millimeter.


The dial indicator also needs to be held in place when taking a measurement. This requires a stand or base. Depending upon the application, these stands can be a clamp type, magnetic or a threaded base.

When taking a measurement, place the contact point on the object to be measured. The dial indicator must be pre-loaded slightly to prevent the measurement from bottoming out.


When reading the scale, be sure to “zero” the dial indicator first. If the readings to be taken are less than 1 millimeter, you do not need to use the small scale. If the readings are larger than 1 millimeter, be sure to factor the small scale into your measurement.

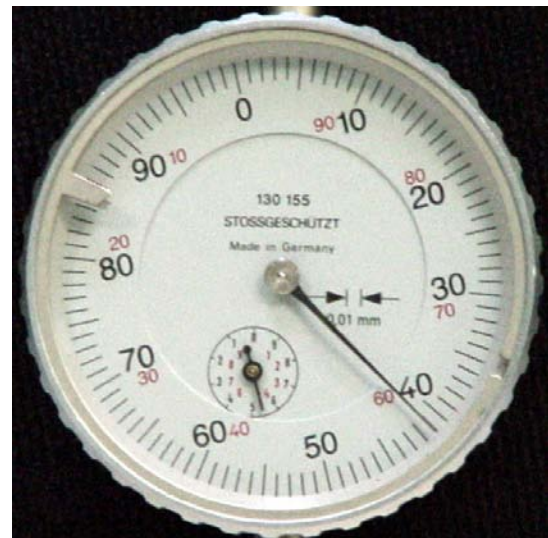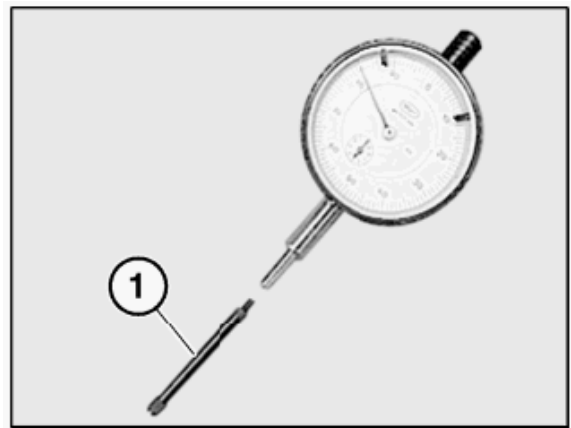

Examples of Dial Indicator Measurements

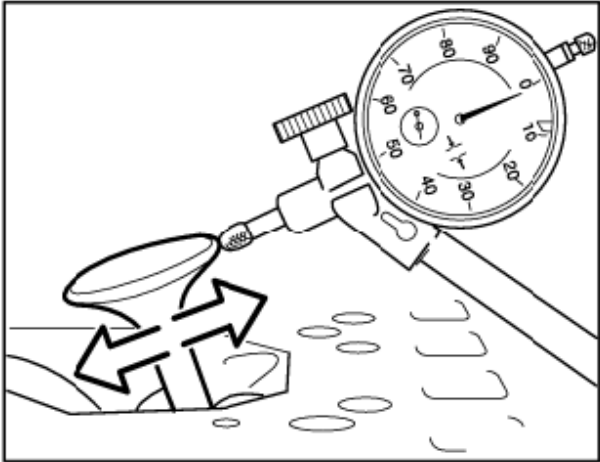

Valve Guide Wear - Tilt Angle "K"

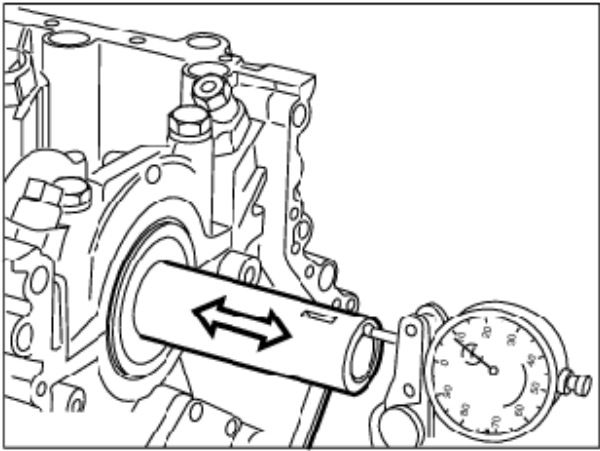

Crankshaft Endplay - Axial




S62 Engine - Basic Throttle Setting



Classroom Exercise - Dial Indicator Measurements


Compare the dial indicator readings, and determine the total travel. Record your results below in the spaces provided.

Dial indicator A

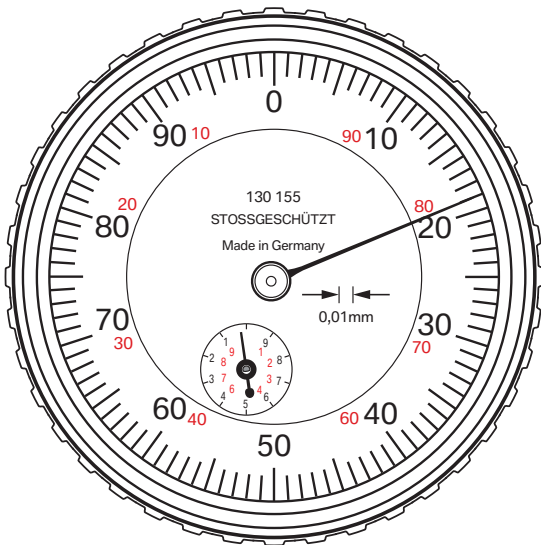


Reading: _____

Dial indicator B

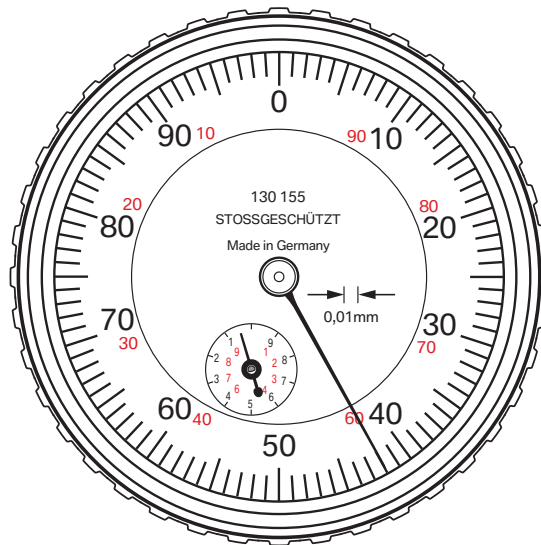


Reading: _____

Dial indicator C

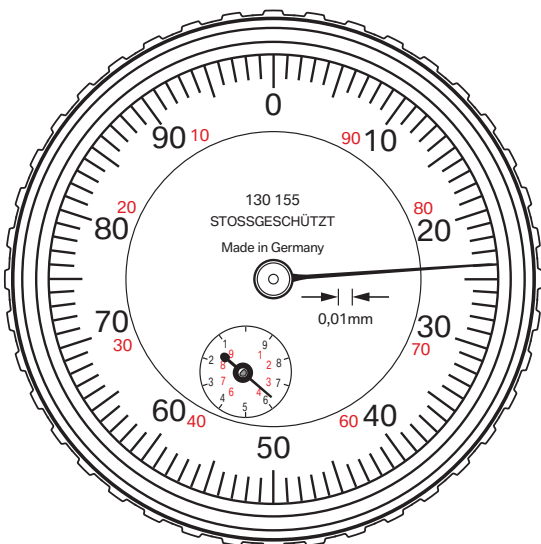

Reading: _____

Dial indicator D

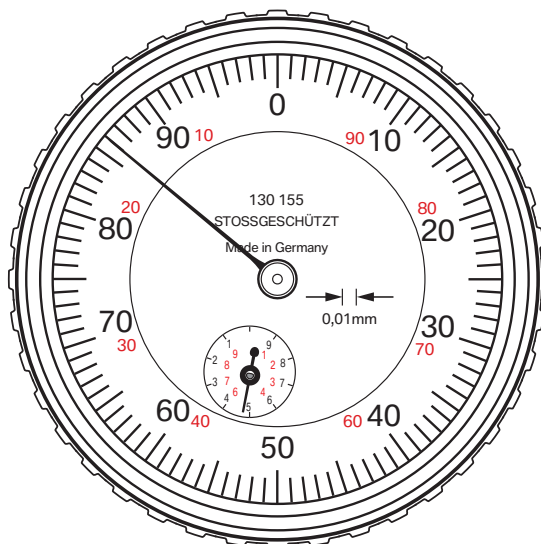

Reading: _____

Additional Engine Measurements

During engine repair procedures it is sometimes necessary to assess engine wear to make determinations on parts replacement. Also, some engine measurements are needed to verify a previous diagnosis.

For example, a cylinder leakdown test could indicate a cylinder sealing concern. Once the engine is disassembled, it would be necessary to verify this condition by checking the piston and piston ring condition. If OK, the next step would be to determine the condition of the cylinder bore. At this point, the cylinders should be checked for taper (conicity) and for out-of-round. The correct measurements could mean the difference between just replacing the rings and/or pistons or replacing the engine block. This is why it is necessary to make accurate measurements when needed.


Some of the other routine engine measurements include:

- Cylinder head warpage
- Cylinder head thickness (on some applications)
- Piston rings - end gap and axial clearance
- * Cylinder bore - including out-of-round and taper

Cylinder Head Measurement


If a repair requires removal of the cylinder head, a few basic measurements can be performed to save time and unnecessary machine shop costs. If an engine has been overheated or has an internal or external fluid leakage (coolant/oil), it is a good idea to check the cylinder head for warpage.

This can be done by using a commercially available machinists straight edge and a feeler gauge. By sliding the feeler gauge under the straight edge in various locations, it can determine if there are any low spots or warpage. The specifications for warpage are found in ISTA under Technical Data. Usually, the specification is about 0.05 mm.

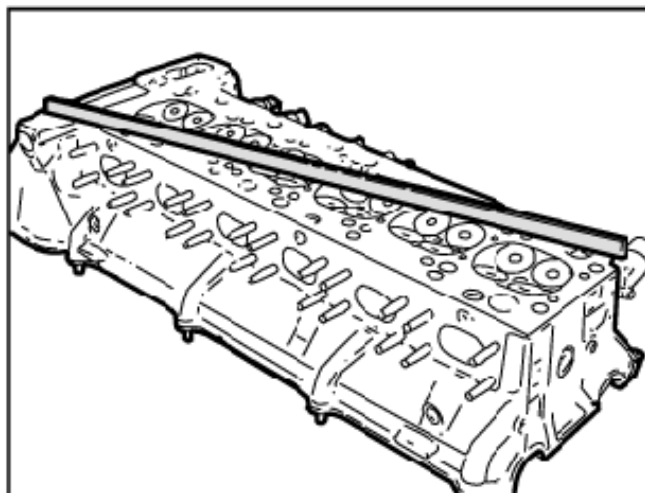

Also, check to see if the cylinder head has a specification for machining limit. If so, it may be possible to have the cylinder head re-surfaced. Depending on the amount of material removed during the machining process, it may be necessary to install a thicker head gasket. There are some “service” head gaskets available through the parts department. The cylinder head can be checked for minimum thickness. This is done using a micrometer or a vernier caliper. This is not possible on all engines, the example shown below is a 6-cylinder (M52TU/M54).


If the minimum thickness is not met, the head will need to be replaced.

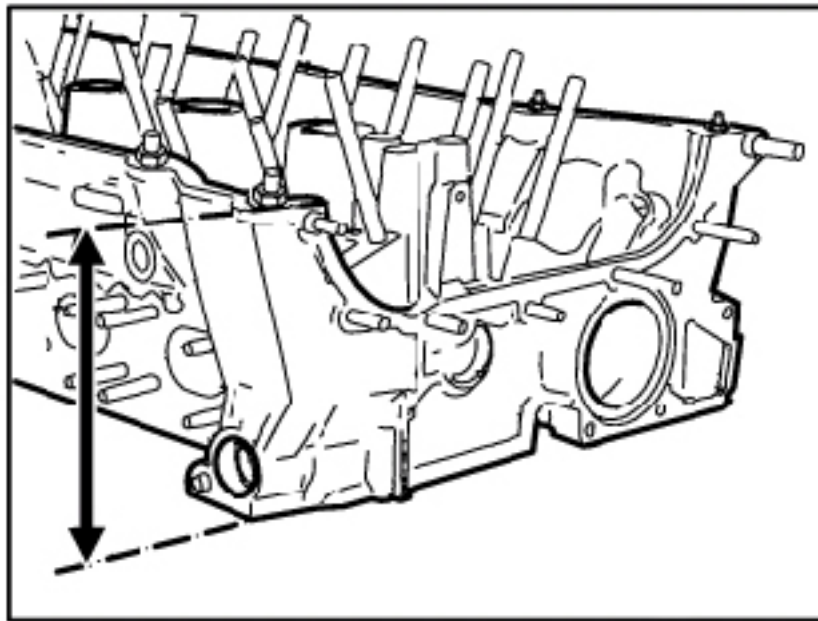

Piston Measurements

When replacing pistons and/or piston rings, there are some basic measurements that need to be made. When fitting a piston to a cylinder bore, the piston diameter should be checked to ensure a proper fit.

The piston diameter is measured using a micrometer. The measurement is taken at a specified point (A) which is 90° from the piston pin axis. Each engine has a specific location to measure piston diameter. For example, the illustration below shows measuring Point A. The specification for this engine (N55) is 12 mm. So the piston diameter is measured 12 mm from the bottom of the piston skirt.

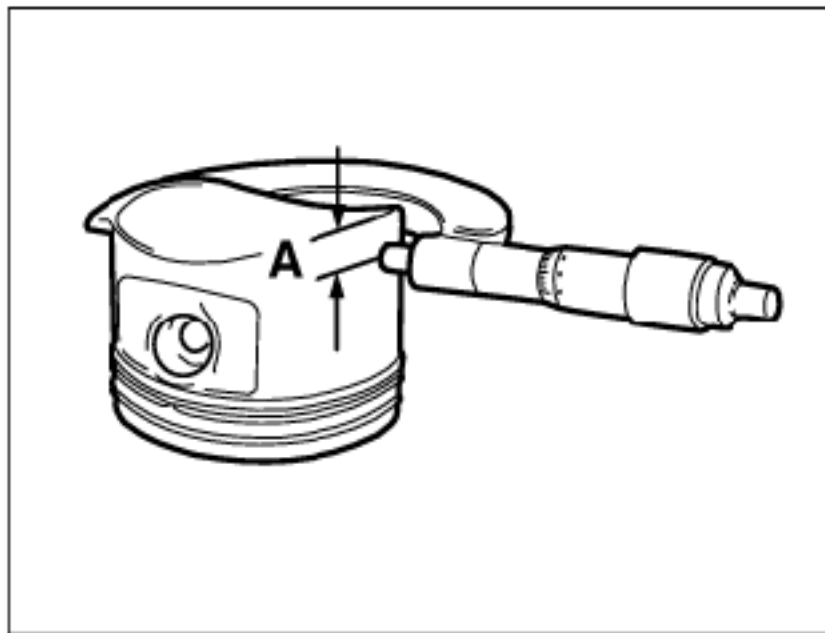

The piston diameter, when subtracted from the cylinder bore equals the cylinder wall to piston clearance. If the clearance measurement obtained is not correct, re-check your readings.



Piston Ring Measurements

There are some important specifications to check when installing piston rings. One of the measurements is axial clearance. Axial clearance is the distance between the piston ring and ring land. This prevents the rings from binding in the ring land at operating temperature. Axial clearance is measured using a feeler gauge.

Also the piston ring end gap has to be checked. This measurement is checked using a feeler gauge.

This clearance is critical in order to prevent the end gaps from contacting each other when the engine is at operating temp.

When installing the piston rings, always stagger the end gaps as per the repair instructions.

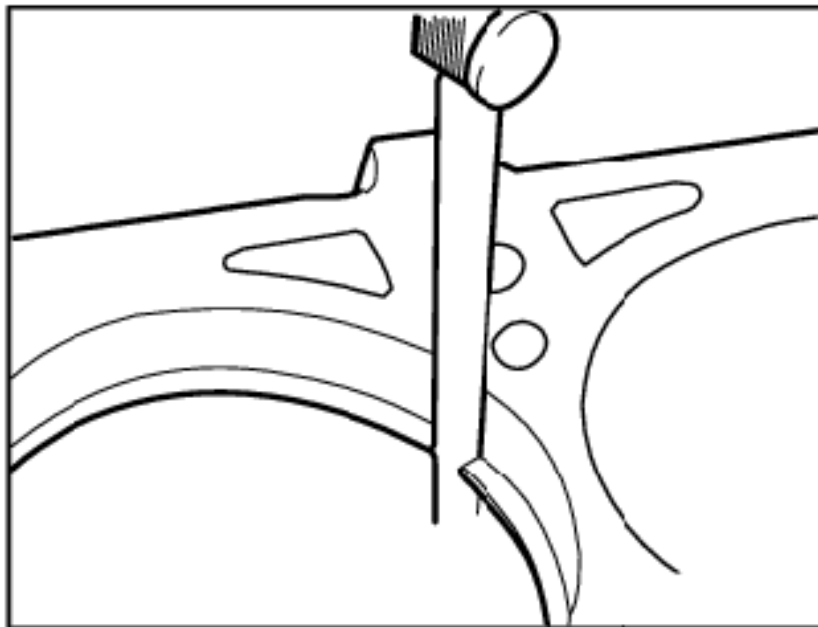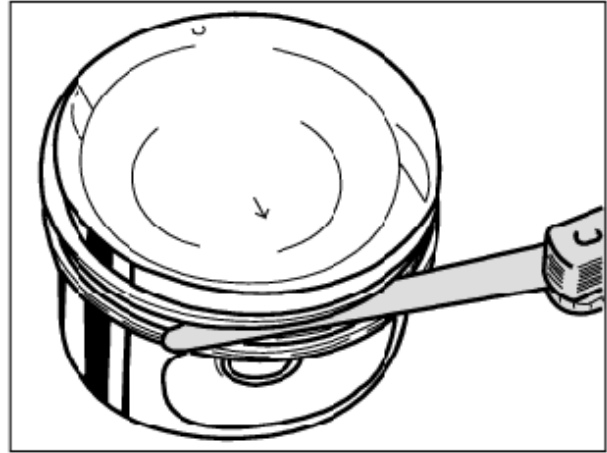


Cylinder Bore

In order for the cylinder bore to be considered acceptable, it must not be excessively tapered or out-of-round. Once the cylinder has been checked for obvious damage and the surface finish is OK, the integrity of the bores must be verified. If cylinder wear is suspected, it must be checked using the proper cylinder bore gauge.

Each cylinder must be checked at three positions in the bore - top, middle and bottom. Also there must be two opposing dimensions that should be checked. The difference between the top and bottom measurements will indicate the taper of the bore. The opposing dimensions will indicate the out-of-round specification.

If these measurements are out of specification, the cylinder bore must be re-finished or overbored. New pistons and rings must be fitted as well.

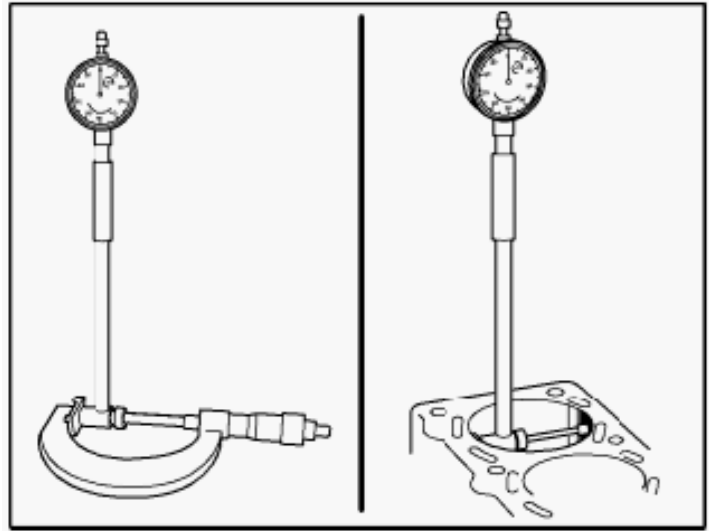

A dial bore gauge is a special purpose dial indicator for checking bores. The most accurate dial bore gauges have an accuracy of 0.0001 in. , or 1/10,000 in.

The dial bore gauge consists of a dial indicator at one end of a long stalk and a tripod arrangement positioned 90° to the stalk at the other end. The tripod is made up of a single interchangeable post that goes against one side of the bore being checked and two hardened buttons at the other end that automatically center the plunger in the bore. The gauge plunger is between the two buttons, directly opposite the post. To allow for different bore sizes, the post is interchangeable. This allows you to measure the big end of a connecting rod or the diameter of a cylinder bore.

Reading Technique

To achieve a reading, the gauge is first zeroed. This is done by measuring across the gauge with an outside mike set to the specified bore size and rotating the dial face until 0 aligns with the needle. The gauge is then inserted into the bore to the desired depth and rocked back and forth until the lowest reading is achieved. When the gauge is square to the bore and the indicator needle reverses direction, the lowest reading is read. This may be on the plus or minus side of the zero, indicating an oversize or under-size bore. Because it's so fast and accurate, the dial bore gauge is most helpful while honing bores for fitting pistons.

How to Use a Dial Bore Gauge

Dial-bore gauges (DB) or dial indicators, when used in conjunction with a micrometer, can give very accurate and precise inside measurements. Used for holes of at least two inches in diameter, they consist of a base that houses an interchangeable anvil that sets the range of the measurement and a small sliding stud that when compressed will give a reading on the gauge or dial portion of the tool. The dial will have a rotating bezel that is rotated to "zero" the gauge at the target measurement, which is set by a separate micrometer. Dial-bore gauges are useful in checking for taper or out-of-round conditions in a cylinder bore as well as many other inside machinists measurements.

Things you'll need:

- Dial bore indicator set
- Micrometer (of the desired range)
- Machinist's rule

■ Setup

1. Determine the rough opening with a machinist's rule. Lay the rule across the top of the bore and dress the zero end of the rule to one edge of the hole. Orient the rule so that the point measured is 180° away from the zero end. Slide the clip down the rule to mark the edge of the hole and record the measurement.
2. Select and install the appropriate anvil. The anvil should be long enough to contact the side of the bore and slightly compress the stud when inserted into the hole. Do not use an oversized anvil and try to force the indicator, as this will likely destroy the accuracy of the tool.
3. Select a micrometer in the appropriate range. Most cylinder bores will be in the two-to-three-inch or three-to-four-inch range. Set the micrometer for the target measurement or for an arbitrary measurement. The arbitrary measurement should be close to the target measurement and be an even number that will be easy to do quick math on to arrive at the actual measurement. Record this number on paper with room to do simple addition problems.
4. Insert the anvil and stud between the micrometers machined surfaces. Rotate the bezel until the "zero" is in line with the needle position. The DB indicator is now ready to read a measurement relative to the setting.

■ Using the Dial Indicator

5. Insert the base of the indicator into the hole. Ensure that the two contact points are 180° from each other and that neither the anvil nor the stud is hanging on scoring or the cross-hatch pattern of the bore wall.
6. Hold the indicator as near to vertical as possible and gently and slightly rock the DB indicator along the anvil/stud axis. The needle will swing clockwise as the tool comes to vertical and the anvil/stud come to their proper position. Read the number on the dial at the point where the needle stops rotating clockwise and attempts to start backing down in a counter-clockwise direction. This is the "relative" measurement. The number may be a positive or a negative. Record this number and remove the DB indicator from the hole.
7. Add or subtract the positive or negative number, respectively, from your target or arbitrary number. This final adjusted number is the actual measurement of the hole.

■ Tips & Warnings


- Clean the hole to be measured and ensure that it is free of oil, grease or particles before introducing a precision measuring tool into the hole.
- Never force precision measuring tools. Permanent and expensive.

Plastigage


Plastigage is used to measure oil clearances on crankshaft main, connecting rod and camshaft journals.

All parts should be free from grease and oil in order to get an accurate measurement. The first step is to assemble the journal and cap with new bearing inserts installed. Make sure all bearing caps are installed properly based on the factory makings.



The next step is to torque all cap bolts to specification. Then loosen the bolts of the bearing cap that you want to check clearance on and remove the cap.

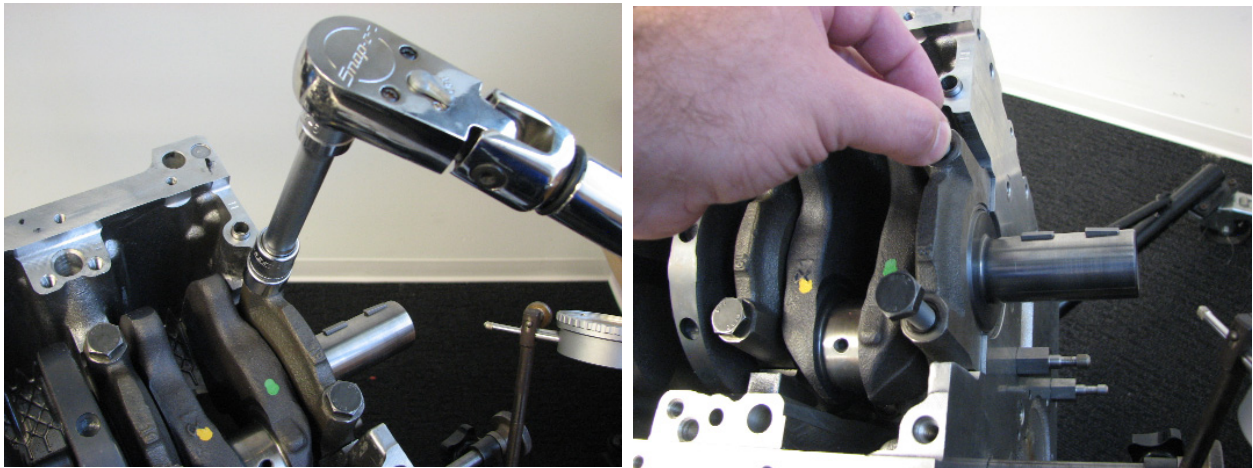


Using a clean, lint free shop cloth wipe any oil off of the surfaces you want to clearance. Cut a piece of Plastigage and remove it from the package. Place the Plastigage across the surface of the journal (in line with the shaft). Install the bearing cap over the Plastigage and torque the cap bolts to factory specification.

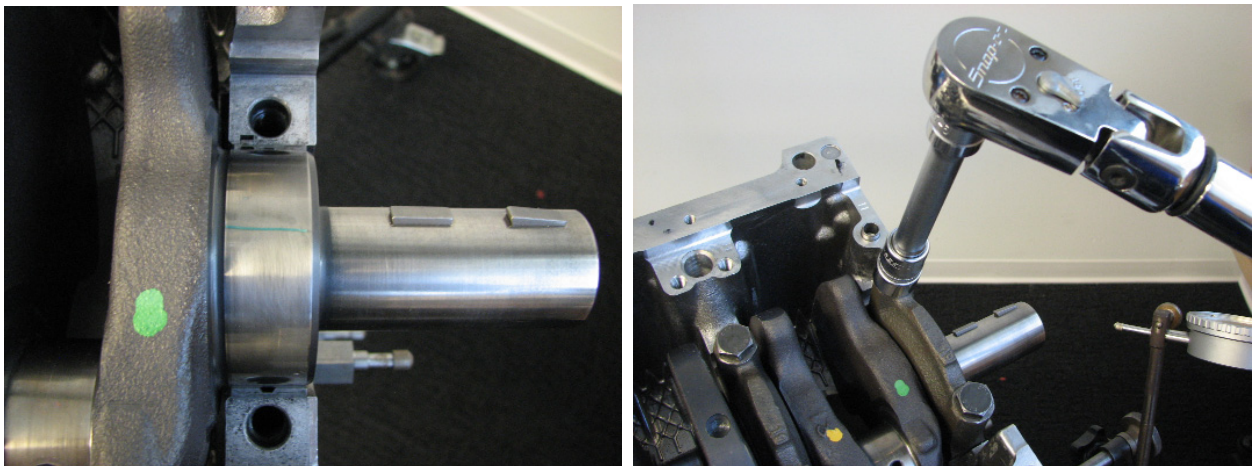

Remove the bolts and the bearing cap once again. You will see the crushed Plastigage on the surface of the journal and bearing insert. Using the scale printed on the side of the wrapper measure the crushed Plastigage imprint.

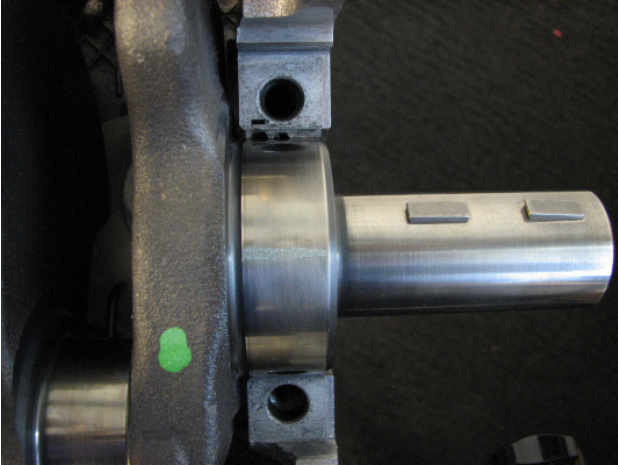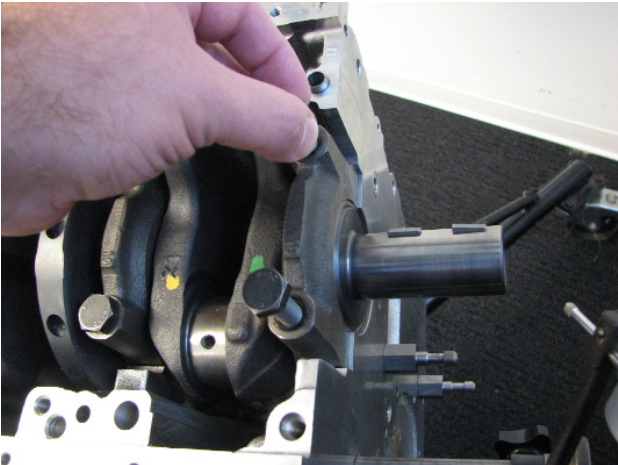

Compare your measurement to the oil clearance specification; if it is within range proceed with assembly. If the measurement falls between two sizes then you can estimate what the size in between is.

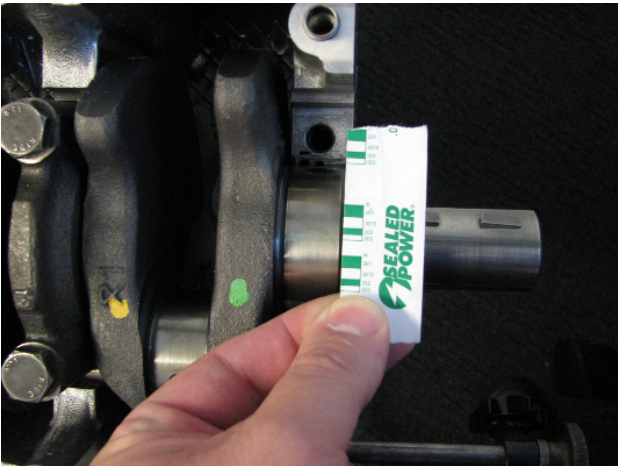

Units of Measure

Metric System

All BMW specifications are metric. Therefore, a thorough knowledge of those areas on the metric system which apply to BMW vehicles is vital to a BMW Service Technician.

The unit of length, and the basis for all other metric units of measurement is the meter. The meter (1 meter), as a point of reference, is slightly longer than a yard (39.37 inches).

The divisions of a meter are hundredths and thousandths. One hundredth of a meter is called a centimeter, and is equal to 0.3937 inch or about half the diameter of a nickel.

One thousandth of a meter is called a millimeter. The small marks between the centimeter increments are each one millimeter, or one tenth of a centimeter. And as a point of reference, a standard paper clip is about one millimeter thick.

Metric System Denominations

Throughout the metric system, common to all units of measurement, are prefixes which designate multiples or fractions of the unit.

For automotive applications, the most common prefixes are centi; designating one-hundredth; milli; for one thousandth and kilo- for one thousand.

There are letters uniformly used throughout the system to label the divisions or multiples of each unit of measurement. The letter "m" represents milli, "c" is for centi and "k" is for kilo. These are then combined with the letter representing the unit of measurement.

For example, mm is millimeter, cm is centimeter and km is kilometer. The same applies to liter which is the unit of volume and gram which is the unit of weight.

One kilogram is equal to one thousand grams which is equal to 2.2 pounds.

All metric measurements are directly related. For example, one thousand cubic centimeters, or 10cm x 10cm x 10cm of water weighs one kilogram. The volume of those one thousand cc's is one liter.

Metric Reference Chart

Weight			
1 kilogram	= 1 kg	= 1000 grams	= 1000 g
1 hectogram	= 1 hg	= 100 grams	= 100 g
1 dekagram	= 1 dag	= 10 grams	= 10 g
1 gram	= 1g		
1 decigram	= 1dg	= 0.1 gram	= 0.1 g
1 centigram	= 1 cg	= 0.01 gram	= 0.01 g
1 milligram	= 1 mg	= 0.001 gram	= 0.001 g
Length			
1 kilometer	= 1 km	= 1000 meters	= 1000 m
1 hectometer	= 1 hm	= 100 meters	= 100 m
1 dekameter	= 1 dam	= 10 meters	= 10 m
1 meter	= 1m		
1 decimeter	= 1dm	= 0.1 meter	= 0.1 m
1 centimeter	= 1 cm	= 0.01 meter	= 0.01 m
1 millimeter	= 1 mm	= 0.001 meter	= 0.001 m
Volume			
1 kiloliter	= 1 kl	= 1000 liters	= 1000 l
1 hectoliter	= 1 hl	= 100 liters	= 100 l
1 dekaliter	= 1 dal	= 10 liters	= 10 l
1 liter	= 1l		
1 deciliter	= 1dl	= 0.1 liter	= 0.1 l
1 centiliter	= 1 cl	= 0.01 liter	= 0.01 l
1 milliliter	= 1 ml	= 0.001 liter	= 0.001 l

Metric System Conversion Charts

Linear Measure to Metric	Linear Measure (Metric) to English
1 inch = 2.54 cm	1 mm = 0.03937 inch
12 inches = 1 foot = 30.48 cm	1 cm = 0.39 inch
3 feet = 1 yard = 0.91 m	1 m = 39.37 inch
5.5 yards = 1 rod = 5.03 m	1 km = 0.62 miles
5280 feet = 1 mile = 1.61 km	
Square Measure to Metric	Square Measure (Metric) to English
1 in ² = 6.45 cm ²	1 mm ² = 0.002 in ²
144 in ² = 1 ft ² = 0.09 m ²	1 cm ² = 0.16 in ²
9 ft ² = 1 yd ² = 0.84 m ²	1 m ² = 1549 in ²
640 acres = 1mi ² = 2.59 km ²	1 km ² = 0.39 mi ² = 247.10 acres
Cubic Measure to Metric	Cubic Measure (Metric) to English
1 in ³ = 16.39 cm ³	1 mm ³ = 0.000061 in ³
1728 in ³ = 1 yd ³ = 0.76 m ³	1 cm ³ = 0.061 in ³
27ft ³ = 1 yd ³ = 0.76 m ³	1 m ³ = 35.32 ft ³
	1 km ³ = 0.24 mi ³
Liquid Measure to Metric	Liquid Measure (Metric) to English
1.81 in ³ = 1 fluid oz. = 30 ml	1 ml = 0.03 fluid oz = 0.061 in ³
1 pint = 0.47 l	1000 cm ³ = 1 l = 61.02 in ³ = 1.06 qt
57.75 in ³ = 1 quart = 0.95 l	1 ft ³ water = 62.5 lb
231 in ³ = 1 gal = 3.79 l = 0.0038 m ³	
1 ft ³ = 7.48 gal = 28.35 l	
Weights to Metric	Weight (Metric) to English
1 Oz = 28.35 g	1 g = 0.035 oz
1 lb = 453.59 g	1 kg = 2.20 lb
1 lb = 0.45 kg	1 metric ton = 1000 kg = 1.102 tons = 2205 lb
1 ton = 0.91 metric ton	
Temperature to Metric	Temperature to Fahrenheit
F = 9/5C +32	C = 5/9 (F-32)

Pressure Conversion Chart

Bar	kPa	psi	in.Hg.
6.0	600	87.0	
5.9	590	85.5	
5.8	580	84.0	
5.7	570	82.5	
5.6	560	81.0	
5.5	550	79.0	
5.4	540	78.5	
5.3	530	77.0	
5.2	520	75.5	
5.1	510	73.5	
5.0	500	72.5	
4.9	490	71.0	
4.8	480	69.5	
4.7	470	68.0	
4.6	460	66.5	
4.5	450	65.5	
4.4	440	64.0	
4.3	430	62.5	
4.2	420	61.0	
4.1	410	59.5	
4.0	400	58.0	
3.9	390	56.5	
3.8	380	55.0	
3.7	370	53.5	
3.6	360	52.0	
3.5	350	51.0	
3.4	340	49.5	
3.3	330	48.0	
3.2	320	46.5	
3.1	310	45.0	

Pressure Conversion Chart (cont.)

Bar	kPa	psi	in.Hg.
3.0	300	43.5	
2.9	290	42.0	
2.8	280	40.5	
2.7	270	39.0	
2.6	260	37.5	
2.5	250	36.5	
2.4	240	35.0	
2.3	230	33.5	
2.2	220	32.0	
2.1	210	30.5	
2.0	200	29.0	
1.9	190	27.5	
1.8	180	26.0	
1.7	170	24.5	
1.6	160	23.0	
1.5	150	22.0	
1.4	140	20.5	
1.3	130	19.0	
1.2	120	17.5	35.90
1.1	110	16.0	32.91
1.0	100	14.5	29.92
0.9	90	13.0	26.93
0.8	80	11.5	23.94
0.7	70	10.0	20.94
0.6	60	9.0	17.95
0.5	50	7.5	14.96
0.4	40	6.0	11.97
0.3	30	4.5	8.98
0.2	20	3.0	5.98
0.1	10	1.5	2.99
0.0	0	0.0	0.0



Review Questions - Basic Measuring Techniques

1. When using a micrometer, why is it important to only turn the thimble using the ratchet (friction stop) when making a measurement?

2. What are the increments on the thimble scale of a micrometer?

3. How should the diameter of a piston be measured?

4. One rotation of the large scale on a metric dial indicator is equal to_____.

5. What are some of the measurement that a dial indicator can be used for?

6. What are some of the measurements that can be performed on a cylinder head?

7. Explain taper and out-of-round on a cylinder bore:
